

## Errata

- LDS/STS when Accessing External RAM
- STS when Accessing EEPROM
- COM1B Settings Never Disconnects OC1B
- UART Loses Synchronization if RXD Line is Low when UART Receive is Disabled
- Releasing Reset Condition without Clock
- Lock Bits at High  $V_{CC}$
- The SPI Can Send Wrong Byte
- Reset during EEPROM Write
- SPI Interrupt Flag Can be Undefined after Reset
- Serial Programming at Voltages below 3.0 Volts
- Skip Instructions with Interrupts

### 11. LDS/STS when Accessing External RAM

Using an LDS instruction for reading external RAM corrupts the source register used in the LDS instruction when directly followed by NOP. An STS instruction for writing to external RAM corrupts R0 when directly followed by NOP.

#### Problem Fix/Workaround

Do not insert a NOP instruction directly after an LDS or STS instruction used for accessing the external RAM.

### 10. STS when Accessing EEPROM

If the STS instruction is used to start an EEPROM write (EWE in EECR), the following instruction may have an undesired result. In the case of NOP, R0 will be corrupted.

#### Problem Fix/Workaround

Use the OUT or SBI instruction to start an EEPROM write.

### 9. COM1B Settings Never Disconnects OC1B

According to the datasheet, Timer/Counter1 should be disconnected from the OC1B pin when  $COM1B[1:0] = "00"$  in non-PWM mode, and when  $COM1B[1:0] = "00"$  or  $"01"$  in PWM mode. This, however, is not the case.

For OC1A, the description in the datasheet is correct; the general digital I/O function takes over.

#### Problem Fix/Workaround

As OC1B is an output only pin with no general digital I/O function, the pin cannot be tri-stated. However, if there is a need to stop the pin from toggling, disable the PWM mode by setting  $PWM[1:0]$  to  $"00"$  and set the  $COM1A[1:0]$  to anything else than  $"01"$  (which is the toggle mode). Warning: As long as the timer is still running, the counter can count to a value above the maximum for that PWM mode. As an alternative, the timer can be stopped by setting  $CS1[2:0]$  in TCCR1B to  $"000"$ .

### 8. UART Loses Synchronization if RXD Line is Low when UART Receive is Disabled

The UART will detect an UART start bit and start reception even if the UART is not enabled. If this occurs, the first byte after reenabling the UART will be corrupted.

#### Problem Fix/Workaround

Make sure that the RX line is high at start-up and when the UART is disabled. An external RS232-level converter keeps the line high during start-up.



8-bit **AVR**<sup>®</sup>  
Microcontroller  
with 8K Bytes  
In-System  
Programmable  
Flash

**AT90S8515**  
**Rev. B**  
**Errata Sheet**

Rev. 1195E-09/01



## 7. Releasing Reset Condition without Clock

If an external reset or a watchdog reset occurs while the clock is stopped and the reset is released before the clock is restarted, the internal reset will time-out after the start-up delay which is independent of the external clock. If no external clock pulses are present in the period when internal reset is active, the reset does correctly cause tristating of the I/O while the reset is held. However, if the internal reset is released before the clock starts running, the part does not clear I/O registers, nor set PC to 0x00. Here, stopping the clock refers to gating the external clock input. Power Down mode does not have this issue.

### Problem Fix/Workaround

Make sure the clock is running whenever an external reset can be expected. If the Watchdog is used, never stop an external clock.

## 6. Lock Bits at High $V_{CC}$

On some devices, the lock bits will not erase at high  $V_{CC}$  and temperature. In this situation, it will not be possible to reprogram the devices when the lock bits are set. This errata strongly depends on temperature and should in most cases not cause any problems at room temperature.

### Problem Fix/Workaround

Lower  $V_{CC}$  below 4.0V before performing a chip erase. Then the device will unlock at any temperature and it will be possible to reprogram the device at any  $V_{CC}$ .

Use rev. C or higher.

## 5. The SPI can Send Wrong Byte

If the SPI is in Master mode, it will restart the old transfer if new data is written on the same clock edge as the previous transfer is finished.

### Problem Fix/Workaround

When writing to the SPI, first wait until it is ready; then write the byte to transmit.

## 4. Reset during EEPROM Write

If reset is activated during EEPROM write, the result is not what should be expected. The EEPROM write cycle completes as normal, but the address registers are reset to 0. The result is that both the address written and address 0 in the EEPROM can be corrupted.

### Problem Fix/Workaround

Avoid using address 0 for storage, unless you can guarantee that you will not get a reset during EEPROM write.

## 3. SPI Interrupt Flag can be Undefined after Reset

In certain cases when there are transitions on the SCK pin during reset, or the SCK pin is left unconnected, the start-up value of the SPI interrupt flag is unknown. If the flag is not reset before enabling the SPI interrupt, a pending SPI interrupt may be executed.

### Problem Fix/Workaround

Clear the SPI interrupt flag before enabling the interrupt.

## 2. Serial Programming at Voltages below 3.0 Volts

At voltages below 3.0 volts, serial programming might fail.

### Problem Fix/Workaround

Keep  $V_{CC}$  at 3.0 volts or higher during In-System Programming.

## 1. Skip Instruction with Interrupts

A skip instruction (SBRS, SBRC, SBIS, SBIC, CPSE) that skips a 2-word instruction needs 3 clock cycles. If an interrupt occurs during the first or second clock cycle of this skip instruction, the return address will not be stored correctly on the stack. In this situation, the address of the second word in the 2-word instruction is stored. This means that on return from interrupt, the second word of the 2-word command will be decoded and executed as an instruction. The AT90S8515 has two 2-word instructions: LDS and STS.

Note 1: This can only occur if all of the following conditions are true:

- A skip instruction is followed by a 2-word instruction.
- The skip instruction is actually skipping the 2-word instruction.
- Interrupts are enabled, and at least one interrupt source can generate an interrupt.
- An interrupt arrives in the first or second cycle of the skip instruction.

Note 2: This will cause problems only if the address of the following LDS or STS command points to an address beyond 400 Hex.

### Problem Fix/Workaround

For assembly program, avoid skipping a 2-word instruction if interrupts are enabled.

The following C-compilers handle this sequence correctly:

- IAR Compiler, version 1.40b or later
- Image Craft Compiler, all versions
- Codevision Compiler, version 1.0.0.5 or later



## **Atmel Headquarters**

*Corporate Headquarters*  
2325 Orchard Parkway  
San Jose, CA 95131  
TEL (408) 441-0311  
FAX (408) 487-2600

### *Europe*

Atmel SarL  
Route des Arsenaux 41  
Casa Postale 80  
CH-1705 Fribourg  
Switzerland  
TEL (41) 26-426-5555  
FAX (41) 26-426-5500

### *Asia*

Atmel Asia, Ltd.  
Room 1219  
Chinachem Golden Plaza  
77 Mody Road Tsimhatsui  
East Kowloon  
Hong Kong  
TEL (852) 2721-9778  
FAX (852) 2722-1369

### *Japan*

Atmel Japan K.K.  
9F, Tonetsu Shinkawa Bldg.  
1-24-8 Shinkawa  
Chuo-ku, Tokyo 104-0033  
Japan  
TEL (81) 3-3523-3551  
FAX (81) 3-3523-7581

## **Atmel Product Operations**

### *Atmel Colorado Springs*

1150 E. Cheyenne Mtn. Blvd.  
Colorado Springs, CO 80906  
TEL (719) 576-3300  
FAX (719) 540-1759

### *Atmel Grenoble*

Avenue de Rochepleine  
BP 123  
38521 Saint-Egreve Cedex, France  
TEL (33) 4-7658-3000  
FAX (33) 4-7658-3480

### *Atmel Heilbronn*

Theresienstrasse 2  
POB 3535  
D-74025 Heilbronn, Germany  
TEL (49) 71 31 67 25 94  
FAX (49) 71 31 67 24 23

### *Atmel Nantes*

La Chantrerie  
BP 70602  
44306 Nantes Cedex 3, France  
TEL (33) 0 2 40 18 18 18  
FAX (33) 0 2 40 18 19 60

### *Atmel Rousset*

Zone Industrielle  
13106 Rousset Cedex, France  
TEL (33) 4-4253-6000  
FAX (33) 4-4253-6001

### *Atmel Smart Card ICs*

Scottish Enterprise Technology Park  
East Kilbride, Scotland G75 0QR  
TEL (44) 1355-357-000  
FAX (44) 1355-242-743

---

### *e-mail*

[literature@atmel.com](mailto:literature@atmel.com)

### *Web Site*

<http://www.atmel.com>

### *BBS*

1-(408) 436-4309

### **© Atmel Corporation 2001.**

Atmel Corporation makes no warranty for the use of its products, other than those expressly contained in the Company's standard warranty which is detailed in Atmel's Terms and Conditions located on the Company's web site. The Company assumes no responsibility for any errors which may appear in this document, reserves the right to change devices or specifications detailed herein at any time without notice, and does not make any commitment to update the information contained herein. No licenses to patents or other intellectual property of Atmel are granted by the Company in connection with the sale of Atmel products, expressly or by implication. Atmel's products are not authorized for use as critical components in life support devices or systems.

ATMEL® and AVR® are the registered trademarks of Atmel.

Other terms and product names may be the trademarks of others.



Printed on recycled paper.